



Accessories

Shear blade 600R set

Part No. 1914E7-7

Set of replacement shear blades. Rough-cut shear blades with a blade length of 600 mm.

Thick shear blades are effective for cutting thick branches.



Charging Time

40 Vizioni max	DC40RA	DC40RC
*1 BL4020 2.0Ah 191L29-0	22 min	30 min
*1 BL4025 2.5Ah	28 min	38 min
*1 BL4040/F 4.0Ah 1910N6-8	45 min	67 min
*1 BL4050F 5.0Ah	50 min	85 min
*1 BL4080F 8.0Ah	76 min	170 min

^{*1} Recommended battery

Chip receiver 600 set

Part No. 1910T2-8





Grease vessel set Part No. 199450-5



Cordless Pole Hedge Trimmer

UNOUT	9
Brake	

Reversing Electronic 3-Speed

Constant Speed Anti-restart function

Low: 1,000 min ⁻¹/Med: 1,500 min ⁻¹/High: 2,000 min ⁻¹ Low: 2,000 min ⁻¹/Med: 3,000 min ⁻¹/High: 4,000 min ⁻¹ w/BL4040/High: 65 min No load speed Cutting strokes per minute Continuous use 600 mm (23-5/8") 38 mm (1-1/2") 2.4 mm (3/32") 20 mm (13/16") Tooth thickness Angle adjustable hedge trimmer head 45° tilt-up to 70° down 93 dB(A) 3, 1.5 dB(A) Noise K factor Vibration level Front grip Vibration level Rear grip 3.3 III/S 1.5 m/s² W/BL4040: 2,268 x 100 x 148 mm (89-1/2 x 3-15/16 x 5-7/8") 1,360 x 100 x 148 mm (53-1/2 x 3-15/16 x 5-7/8") 4,7 - 5.9 kg (10.4 - 13.0 lbs.) BL4020 - BL4080F Vibration K factor Dimensions (L x W x H) Dimensions (folded) Net weight Net weight (Battery) Standard Equipment: Blade cover, Shoulder harness, Battery, Charger

The weight may differ depending on the attachments, including the battery cartridge. The lightest and heaviest combinations, according to EPTA-Procedure 01/2014, are shown in the table.

Makita Singapore Pte Ltd

7, Changi South Street 3, Singapore 486348 Phone: +65-6546-8700 Fax: +65-6546-8711 Email: msgproductteam@makita.com.sg Website: www.makita.com.sg Facebook: www.facebook.com/MakitaSG







VISIT OUR WEBSITE DOWNLOAD LEAFLET

PRINTED IN SINGAPORE



Cordless Pole Hedge Trimmer UN001G





Lightweight and capable of cutting thick branches.







Designed to be lightweight and capable of cutting thick branches

The tool is capable of cutting thick branches due to an increased power obtained by the 40Vmax XGT li-ion battery and thick shear blades. Higher operator's convenience has been achieved by drastically reducing the weight of the tool compared to competing engine models.



Maximum branch diameter*1

25 mm

Maximum cutting diameter*2

20 mm

Tooth thickness

*1 Indicates the maximum diameter of a branch that can be received between adjacent two blade teeth. *2 The thickness of a branch that can be cut by pressing the shear blades against it for two seconds.







Lubrication is possible with a grease gun

Maintenance efficiency has been improved by adding a grease nipple and allowing oil to be supplied with a grease gun without removing the bolt on the oil supply port.






Users who do not own a grease gun can remove the bolt and supply grease with a grease tube as with our current models.



Improved durability of Angle adjustment section

The following two structures have been redesigned to reduce sliding wear of Head section angle adjustment mechanism, thereby reducing the occurrence of backlash.

- Two brass washers are installed on both sides, and the brass washers slide against each other to prevent wear of the tool body, reducing backlash.
- A steel sleeve is added to the hole in the case of the tool body where Angle adjustment pin is inserted to prevent wear of the hole.

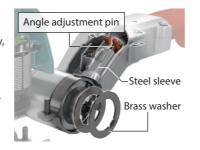

Three-facet obliquely ground blade Double-sided rough-cut type



Optimal balance of Head section

Head section is positioned on the extended line of the pole to provide an optimal balance,




Reverse function to clear jams

is jammed by thick branches



Foldable storage

Reverse rotation system frees the blades when it

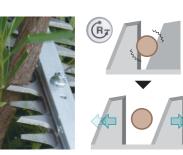

UN001G Blade Length:

600 mm (23-5/8")



By adding a lock lever to the lock-off lever, the automatic power-off time has been revised, enhancing work efficiency.



IPX4-compatible

High water-resistance



Adjustable blade angle

The angle of the head can be adjusted in 6 steps at between 45° upward and 70° downward.

